

OASIS Frequently asked Questions (FAQ) for WWTS

Revision v1.4

Jul 18th 2023

11717 Exploration Lane, Germantown, MD 20876 Phone (301) 428-5500 Fax (301) 428-1868/2830

Copyright © 2021 Hughes Network Systems, LLC

All rights reserved. This publication and its contents are proprietary to Hughes Network Systems, LLC. No part of this publication may be reproduced in any form or by any means without the written permission of Hughes Network Systems, LLC, 11717 Exploration Lane, Germantown, Maryland 20876.

Hughes Network Systems, LLC has made every effort to ensure the correctness and completeness of the material in this document. Hughes Network Systems, LLC shall not be liable for errors contained herein. The information in this document is subject to change without notice. Hughes Network Systems, LLC makes no warranty of any kind with regard to this material, including, but not limited to, the implied warranties of merchantability and fitness for a particular purpose.

Trademarks

HUGHES, HughesNet, HughesON, IPoS, SPACEWAY, and JUPITER are trademarks of Hughes Network Systems, LLC. All other trademarks are the property of their respective owners.

Revision History

Revision	Date of Issue	Comments
1.0	05/05/2022	Initial Draft
1.1	05/12/2022	Includes feedback from WWTS
1.2	08/18/2022	Includes more points from field support
1.3	03/22/2023	Includes FAQ for recovering additional assets, Arrival Not Onsite, and other recent enhancements
1.4	07/18/2023	Includes FAQ for Software Upload feature added to the workflow



This document is a quick reference for common questions and troubleshooting steps for the Hughes OASIS application.

Any OASIS issues (including WWTS repairs), please contact Install support.

Training resources, such as a full OASIS user guide and training videos, are available in the <u>Installation</u> <u>Portal</u>.

I. Recommendations

- 1. OASIS Supported App version
 - a. Recommended App version 7.15.08 and above.
- 2. WWTS Managed devices
 - a. Samsung S20

3. Other recommended devices (Not for direct WWTS techs)

- a. Android OS version# 7.0 and above
 - <u>Android Model</u>s: Samsung Galaxy NOTE 5/ Note9, Samsung S9, Google Nexus 6, Google Pixel XL and Pixel 5, Moto G10, Huawei P30 lite Android 10, Samsung A50 - Android 10, Samsung Tab S2
 - Minimum Hardware Specifications: At least 5MP Camera with Auto-focus, Compass sensors (Accelerometer/Gyroscope), 4GB RAM, and 500 MB Free Storage to support App data/attachments.
- b. Apple iOS version 12.0 and above
 - i. <u>Apple models</u>: iPhone 7/8/iPhone X, iPhone XS Max, iPhone 11, 12, XR
 - ii. <u>Minimum Hardware Specifications</u>: iPhone 7 and above, 500 MB Free Storage to support App data/attachments.

4. Jupiter-VSAT Terminal Activation

- a. OASIS currently supports the following VSAT models.
 - i. HT2000, HT2000W, HT2010, HT2010W, HT3000, HT3000W, HT2510, HT2510W
- b. For HT2000, HT2010, HT3000, HT2510 an external Wi-Fi router is needed to connect with OASIS. Use the VSAT LAN port to connect with external Wi-Fi router.
- c. Any other VSAT terminal model outside of the above mentioned supported list needs to be activated manually outside OASIS. The manual activation steps are captured in the training videos & install specification documents. However, OASIS still needs to be used to complete the rest of the non-terminal workflow steps like Arrival IVR, Line of Sight, Safety, BOM (Bill of Materials), Before/After Photos, Signatures, Audit & Departure.

II. Important Tips

- 1. Do sync your device every morning when you have a good Wi-Fi or LTE connection, before leaving for your first order. To do this, press the "Sync" button on the OASIS home page. Syncing multiple times throughout the day is good practice.
- 2. Do enable cookies in your device's default browser settings. Cookies are required for certain OASIS functions to work properly.
- 3. <u>Do</u> review your app's configuration by navigating to "Config" on the OASIS home page. This allows you to configure things such as sync intervals and photo settings.



- 4. Do update your mobile device's OASIS permissions for access to Location Services (for GPS coordinate capture), photo access, push notifications, etc.
- 5. **Do** review OASIS home page announcements, notes, and push notifications for installation and OASIS updates.
- 6. **Do** update to the most recent OASIS app version whenever possible.
- 7. Don't allow old records to pile up, as it can cause the OASIS app to become slow or crash. Clean out old records by going to "All Records" on the OASIS home page and deleting completed FSOs that have a green cloud and check-mark next to them (this indicates the FSO data was successfully uploaded to the Installation Portal). We recommend you do this at least once a week.
- 8. <u>Don't</u> close the app if you want GPS tracking to keep running. The app needs to be running in your device's foreground or background to track your location (e.g., when using enroute).

III. Common Issues & Questions

1. iOS Certificate Error

- a. iOS Certificate Issue ("Untrusted Developer" error) (Not for WWTS managed devices)
- b. On your iOS device, go to: Settings \rightarrow General \rightarrow VPN & Device Management
- c. Select the "**Hughes Network Systems, LLC**" option in the Enterprise App section and tap on the option "Trust Hughes Network Systems" to validate the certificate.

2. Password expired error. How do you reset your password in OASIS?

- OASIS and the Installation Portal share the same credentials and authentication process. If your password has expired, log in to the Installation Portal (<u>https://install.hughes.com</u>) and try to log in using your old password. The Installation Portal will prompt you to reset your password.
- b. If your password is lost/forgotten, use the "**Forgot Password**" link on the Installation Portal login page or the OASIS login page to reset the password. Once the password is reset, try the updated password in OASIS.

3. Unable to install the OASIS Application

a. If unable to find the OASIS app in your phone menu or trouble installing the OASIS application, please reach WWTS IT/tech support for installing the OASIS recommended app version on your device.

4. Trouble logging into OASIS


- a. Make sure you are on the recommended app version 7.11.00 and higher
- b. Make sure you are using WWTS provided Samsung S20 phone, the app is not supported on any other WWTS provided devices
- c. Ensure Wi-Fi is enabled and have Internet Connectivity.
- d. Make sure the Installation Portal is operational by logging in via a web browser from same device. If your password has expired, reset it following the steps mentioned in #2.
- e. If above steps still not resolve the issue, contact WWTS IVR# 1 978-848-9301 24x7 option 1,2,4, there's code to redirect to Hughes IVR


5. Sync from OASIS App is taking a long time (more than 3min)

- a. Check connectivity and try to sync with faster internet (preferably Wi-Fi).
- b. Cleanup old jobs and try again to sync Go to All Records and make sure to upload all the data to the server and then delete any old, completed FSOs, then try again.
- c. If still taking longer (more than 2min), try to sync only the jobs that are required for the day using the sync icon (placed top left corner on the FSO Card as highlighted **#3** in the Fig 4.2 below)



d. Do not interrupt or close the app while sync in progress. **Please be patient while app is synchronizing your data and follow the status messages and progress %**. This may take a while sometimes depending up on the load and connectivity, but it's required to wait until the sync is 100% successful and complete.

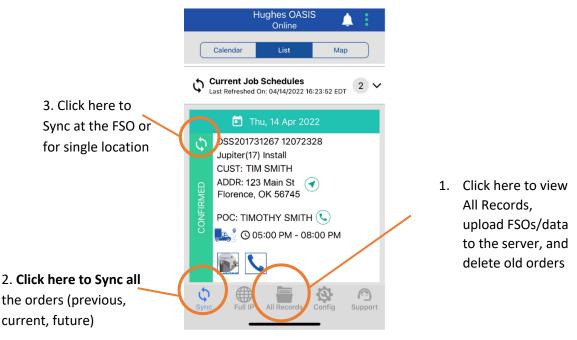




- 6. Unable to see an FSO in my OASIS app.
 - a. OASIS will not sync orders that are closed/completed or canceled. Make sure the order has a status of "In Progress."
 - b. OASIS will only sync orders with a tentative or confirmed scheduled date. OASIS will not sync orders with past scheduled dates, so make sure the FSO has been scheduled for the current date or a future date.
 - c. Make sure the FSO is assigned to the same installer ID that is being used for OASIS. Check with the technician's Dealer/Distributor for further help if any reassignment or rescheduling needs to be done.
 - d. If you are looking for an order that is scheduled more than 7 days in the future, go to the Config menu in OASIS and change the scheduled days from the default (7 days) to a different value up to 30 days.



4:44 -9 and 1	•	4:45 4	al 🗢 💷
Test Env Hughes OASIS UATI Online	1 :	← User Configuration	
Calendar List Map		() Account	IN4
Previous Job Schedules Last Refreshed On: 10/27/2021 18:44:40 EDT	0	Schedule Days	7 Days ¥
Current Job Schedules	1	Sync Interval(Download)	6 Min ₹
- Uushas Matas		Sync Interval(Upload)	15 Mins ▼
Hughes Notes Last Refreshed On: 10/27/2021 18:44:38 EDT		Sync Data (Select Network)	Always ▼
Announcements Last Refreshed On: 10/27/2021 18:44:38 EDT	:	Auto-Upload Photos (Select Network)	Wi-FiOnly ▼
		Photo Resolution	Medium ¥
Tools (Offline)		App Theme	Light 🔻
ආ) Technician Badge		Export to Gallery	Yes ¥
u) Technician Badge		_	Done
∏ V		1 Day 7 Days 14 Days 21 Days	
\wedge			
Sync Full IP All Records Config	Support	Home Full IP Config	Logout
V			

- 7. OASIS App is crashing intermittently.
 - a. When you encounter any app crash, it is recommended to re-open the app and re-try with same steps to proceed to the next steps in the workflow.
 - b. Make sure you upload the past jobs and clean up your job history in OASIS Home→ All Records to free up some memory, then give a re-try.

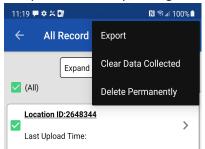

- c. When you repeatedly encounter the same behavior/crash on your device, make sure the device meets the minimum hardware specifications provided in the <u>recommendations section (Refer section 1.3)</u> and has required permissions enabled for OASIS app to function (Ex: Photos, location services, storage etc.,)
- d. Check your app permissions from the device settings (Refer section III.7 & III.8)
- e. It is also possible that your phone ran out of resources like storage, CPU utilization etc., depending on other apps running and space being consumed in the background.
- f. Try to close/kill the other apps running in background and retry launching the OASIS. Sometimes restarting your device could help to clean up cache and other resources being consumed by the device.
- g. If still not resolved, you may try with uninstalling the app and installing the latest app from Hughes Appstore (seek help from WWTS support if it's a managed device to get the latest app installed on your device). Make sure you have uploaded the data/photos before you uninstall the app. If not able to upload photos from OASIS, you can export the photos to gallery (if not exported already), and then you can re-import the images to OASIS and upload them.
- h. If problem persists, please reach **Install support** for further help. Please be specific on sequence of steps to help support team to reproduce the issue on their end. Also



Last update: 07/18/2023

version: 1.4

make all device & OASIS details are provided (OASIS App version#, OS version#, device model, Installer#, FSO# if applicable)

- GPS Permissions Having issues with GPS functionality in OASIS.
 - 1. Make sure you have **location services turned ON** in device General settings.
 - Settings → Location

8.

- 2. Also make sure location permissions are turned ON in OASIS app settings
 - Settings \rightarrow Apps \rightarrow Hughes OASIS \rightarrow Location permission

1:08 🗭 🌣 🛠 🕼	🕅 🕾 al 100% 🛍	11:09 🗮 🕈 🏠
< Location		← Location permission
On		Hughes OASI
App permissions		
Improve accuracy Use Wi-Fi and Bluetooth for more detection.	e accurate location	location access for the Allow all the time
Recent location requests		Allow only while usi
No apps have requested	d your location	- · ·
Location services		Ask every time
G Emergency Loca	tion Service	ODeny
G Google Location	Accuracy	See all Hughes OASIS pern
G Google Location	History	
G Google Location	Sharing	
III O	<	III O
6.1 - Genera	l permissions	Fig: 6.2 - App pe

- 9. **Camera Permissions** phone camera doesn't launch.
 - 1. Make sure Camera permissions are turned ON
 - 2. Go to Settings \rightarrow Apps \rightarrow Hughes OASIS
 - 3. Open Permissions \rightarrow Camera permissions
 - 4. Make sure "Allow only while using the app" is selected



	3:27 🗭 🌣 🎇 🕼	N ®.1 1	00%	11:23 🗭	¢ X 🗊	🛯 🗊 📶 100% ੈ
	< App info			← 0	Camera permission	۹
	Hughes O Installed	ASIS	ſ		OASIS	
	Privacy				Hughes OASIS	
	Notifications Allowed					
0	Permissions				CAMERA ACCESS FOR THIS A	APP
	Camera, Location, Phone	, and Storage			Allow only while usir	ng the app
	App timer				A ale avany time	
	Defaults			\bigcirc	Ask every time	
	Set as default Not set as default			\bigcirc	Deny	
	Usage					
	Mobile data No data used				See all Hughes OASIS permi	ssions
	Battery None since device last fu	illy charged				
	C Open U	force st	ор			
	111	0 <				

10. GPS not capturing arrival on site or GPS capture is not accurate.

- a. This may be due to poor cellular service. Make sure GPS location permissions are turned on in device settings and try to capture GPS location again.
- b. If you are trying to capture the GPS from inside the building/basement, try to capture from outside the building with an open sky for better satellite signals.
- c. If still not resolved and unable to capture device GPS, use the ordered lat/long to activate service, and then correct the lat/long later (if needed) after HughesNet service has been activated.
- d. Note: Occasionally, the GPS coordinates captured may be significantly different from the lat/long expected from the order. When this happens, you will receive a pop-up message to confirm you are at the correct location. The captured lat/long from your device is typically more accurate than the ordered lat/long, so if you confirm the order is for the correct customer, then use the lat/long you captured in OASIS and continue to next steps.
- 11. The LOS (Line of Sight) tool in OASIS is not functioning properly (e.g., the crosshairs are not moving correctly **VSAT HTXXXW terminals only**).
 - a. LOS interacts with native compass inside the device. Your device model must have a compass sensor built in (most modern phones do).
 - b. Compass can freeze in some exceptional cases. Recalibrating or lightly shaking the device can sometimes help the compass needle reset and work much better.
- 12. My device is not able to correctly scan the barcodes.
 - a. Your device must have a rear-facing camera with at least 5-megapixel resolution and autofocus. If your device is unable to scan a barcode, make sure you select the part from the list of part's available in OASIS and enter the corresponding serial number manually.




version: 1.4

- 13. Unable to connect to the terminal (Wi-Fi or IDU step has status of "Connection to IDU Failed," or OASIS fails to ping the terminal or query pointing statistics on the Sat Install step) (VSAT HT20X0W terminals only)
 - a. Go to your device's Wi-Fi settings to ensure you are connected to the modem's Wi-Fi network. (Note: only devices with Wi-Fi capability can connect via Wi-Fi)
 - b. Go to the Sat Install step and tap on the terminal icon. You will see a pop-up message "Terminal (IDU) is Unavailable, do you want to continue?" Tap "Yes." This will launch a browser on your phone and will try to connect with the terminal's LUI. After the browser connects and displays the LUI, go back to the OASIS app. You should now be able to connect with the terminal.
- 14. Unable to load a photo or am having other problems on the photo screen of OASIS
 - a. If you have already completed the Departure workflow, OASIS will lock some features. You need to re-arrive on same site to capture the photos. If you have multiple old FSOs stored on your device, this could cause memory issues with the app. Ensure all old FSOs are uploaded to the Installation Portal, then delete/clear them all from records screen.

11:19 🗭 🛱 🕅	Ŋ 🤶 ៧ 100%
← All Record	Export
Expand	Clear Data Collected
🗹 (All)	Delete Permanently
Location ID:26483	44
Last Upload Time:	


- 15. Loading on photo screen after taking a picture.
 - a. Photos might be set to too high of a resolution. Close OASIS (ensure it's not running in the background)
 - b. Go to OASIS Home→open Config screen, change photo resolution to Medium or low and try again.

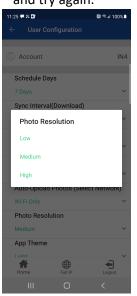

16. I am receiving a warning that a photo is "Not Qualified" and may fail photo audit.



- a. The photo is failing an automatic check. OASIS uses artificial intelligence (AI) to help ensure good photo quality (e.g., not blurry) and subject matter classification (i.e., is the photo similar to a database of other "good" photos). This technology is not necessarily intended to judge installation quality. It is possible that a photo may pass AI but fail a human-reviewed photo audit, and vice versa. If you receive the "Not Qualified" error but believe the photo is good quality and would pass an installation audit, then tap "Proceed" to keep the photo. Otherwise, try to re-capture the image for a better photo.
- 17. OASIS is not showing the FSO that was previously completed (data loss)
 - a. Look for FSO in both previous schedules and then check if it's listed in the All Records screen. All Records lists all your saved work orders that are completed/work in progress or to be done etc., If any FSO was deleted from the All Records page by accident, it is not possible to recover it.
 - b. xular safeguards: 1) Log in to the Installation Portal before deleting any FSOs from records to ensure all data was uploaded; 2) Export photos and signatures to your device's photo gallery just in case there is data loss; 3) Keep All Records clean by deleting old completed FSOs that have been successfully uploaded, as storing too many old FSOs may cause strange data issues.
- 18. Issues uploading FSO information (attachments) to the Installation Portal
 - a. Make sure you have a stable and strong Internet connection (i.e., 4G should be good).
 - b. Make sure the Installation Portal is operational by logging in via a web browser. Try to resubmit your upload from OASIS Records step, tap "Submit Data to Server" to resubmit the FSO data.
 - c. If you are trying to upload multiple FSOs at once, try instead to upload one at a time.
 - 1. If still not resolved, use the "Export Attachments" option from the All Records screen to save all the attachments to the device gallery. Now, you can upload those manually through the Installation Portal, via a web browser.

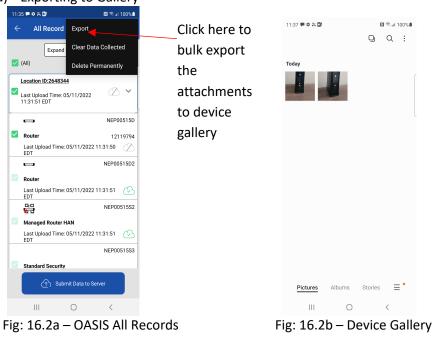

a) Exporting to Gallery

- b) Uploading via Installation Portal
 - 1. Open FSO in Installation Portal using same mobile browser



2. Use "Add Attachments" button at top to upload the pictures from device gallery.

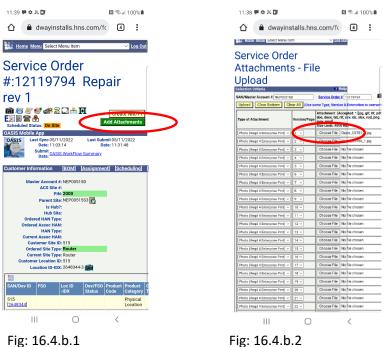


Fig: 16.4.b.1

- 19. Lost data when I switched to a secondary login.
 - 1. OASIS stores the information of only one user at a time. Switching to another installer login will erase the previous user's data. OASIS warns you before it deletes the previous user's data.
- 20. Unable to identify the sim part# while scanning
 - a. If Sim cards are provided with a prefix like "HU- "and followed by the actual part number; For Ex: HU-1503362-0026, edit manually and strip off the extra chars "HU-"from the part number field in OASIS, then try the look up(click on magnifying glass icon) to re-download the part configuration



11:43 ■ 	*	N ®⊒ 100%∎
Before Photos	вом	
Expand All	Collaps	ie All
OTHERS (Optional) Are you scanning SIM	card? 💽 Yes 🤇	No
P/N HU-150 (Skip P/N if its SIM, ZT	3362-0014 P enabled)	
SIM Card Verizon Onl	y Device Type	
💓 🗹 Is ZTP		SIM
Condition	Inv Category	
New 🝷	Consigned	•
S/N (ICCID)		
HOST BY		
		•
Scan separately		
	0	<

Fig: 18.1

- 21. IVR has been submitted in OASIS but missing in IP
 - a. After Departure submit, make sure you hit "Submit data to server" in records page to upload the latest information collected in OASIS to Installation Portal (IP).

Device Info	>
Upload Section	>
Fig: 19.1	

b. <u>If no Internet at customer location</u>, you can submit anytime when you have the connectivity. You can submit single FSO/location like show above or do bulk submit from All Records in home screen.


Home \rightarrow All Records \rightarrow Select the Location/FSOs \rightarrow Click Submit Data

- 22. Unable to complete required photos
 - a. Make sure all red highlighted pictures are completed in before photos before you work on installing the BOM.
 - b. Click anywhere on the description cell to capture the photos configured for the site



N 🖘 🛛 100% 🗎

- c. Use (+) icon if like to capture any additional other photos for the site, enter the description manually in input field provided.
- d. <u>Take the required photos for dispatched device (even if you don't have to work on it)</u> and take the optional photos for additional devices

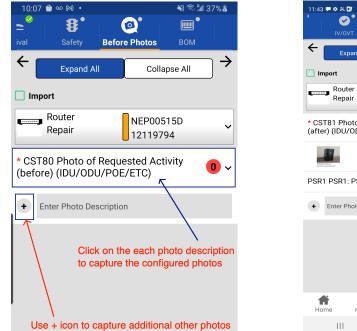

Sector 1		Q	e,	
IV/0	VT Afte	er Photos	Audit	
←	pand All	Collaps	e All →	•
lmport				
Rour Repa		NEP00518 12119794		
* CST81 Ph (after) (IDU	oto of Req /ODU/POE	uested Acti /ETC)	vity 🚺 🗸	
and the second				
PSR1 PSR1	: PSR Phot	:0	0 ~	
+ Enter P	hoto Descrip	otion		
H ome	Records	Notes	More	
111		0	<	

Fig: 20.1 – Before Photos (Red - Required Missing)

Fig: 20.2 – After Photos (Green – Completed)

- 23. Unable to arrive on location
 - a. It is required to Click "Arrival On Site" button in the Arrival workflow step, followed by entering the optional notes. Tapping on "Submit" will successfully submit the IVR on location. Scroll all the way down if you can't find the Submit button on your screen.
 - b. In case of any IVR error in OASIS, OASIS provides an option to acknowledge the error popup and continue with the job. The IVR time will be stored in OASIS and uploaded when there is connectivity.




9:58 🛋	•8≊•		😧 ¥ 🙃 💷 3	% ∄
L.	ջ •	<u> </u>	8	
Route	GPS	Arrival	Safety	Befc
← ✓ Sel	ect All			\rightarrow
	Router Repair 2022-08-1	DO	3220003337 3879	>
S	Dedicated AD L2	SL DEG2	517288881S2	2
•-	Wireline Mode	em DEG5	109654815M	>
B	Managed Rou	Iter DEG8	011543423S0) >
	Router	DEG3	220003337D0) >
Â0 QT	Active QoS	DEG3	933926066S1	>
	Acceleration Appliance	DEG2	29312364AA	1 >
	A	rrival On Site		
	111	0	<	

- 24. Work order showing as "Suspended" in OASIS
 - a. "Suspended" is a valid status if technician has done "Departure Incomplete". If the installer is submitting the "Departure Incomplete" IVR, order will be moved to the suspended state.
 - b. It is recommended to work with the Dealer/Distributor (WWTS) to get the job rescheduled to a future date to change the job status to "Confirmed/Tentative".
 - c. However, if the installer is already at site, and order is in suspended state, the installer is allowed to re-arrive and submit "Arrival Onsite" as next visit if the work order is still saved & visible in OASIS calendar.
 - d. Note: Here are the different valid statuses for a given order. These statuses are also available in the Installation portal service order search screen.

Scheduling Status: Row Colors			
Unscheduled	(UnS) Not Scheduled (Not In Calendar)		
Tentative	(Tnt) Only Tentative Scheduling (Not in CG Calendar)		
Confirmed	(Cfm) Confirmed Scheduling		
On Hold	(HId) Any On Hold Status		
En Route	(EnR) IVR - En Route		
On Site	(OnS) IVR - Arrival On Site		
Completed	(Cmp) IVR - Departure Complete, Closed, Installed/Repaired, Activated - Pending Merge		
Suspended	(Spd) IVR - Departure Incomplete, Stop - En Route		
Canceled	(Cnl) Canceled (Not In Calendar)		




- 25. OASIS is taking the installer to departure screen when trying to access photos or any other workflow step
 - a. Usually, this issue can occur when "Departure Incomplete" was not submitted on the previous visit (visits that are more than a day old) and trying to access photo/other workflow steps on the next visit.
 - b. When OASIS prompts, submit "Departure Incomplete" for the previous visit.
 - c. Navigate to Arrival workflow step and submit "Arrival On Site" for the current visit.
- 26. Unable to Launch OVT/IV in mobile browser
 - a. OVT/IV is launched outside of OASIS in a mobile browser window and if pop ups are disabled, OVT/IV fails to launch.
 - b. Follow the steps below to enable the pop ups and try again.
 - For Example Enable Chrome browser pop-ups on Android devices:
 - 1. Launch the chrome browser app on your Android phone.
 - 2. Tap on the menu for more options.
 - 3. Select Settings from the list of options.
 - 4. Scroll down and Tap on the "Site Settings" option.
 - 5. Within Site Settings screen, open "Pop-ups and Redirects"
 - 6. The "Pop-ups and Redirects" are set to "Blocked" by default.
 - 7. Toggle the button and set to "ON" to allow pop-ups.

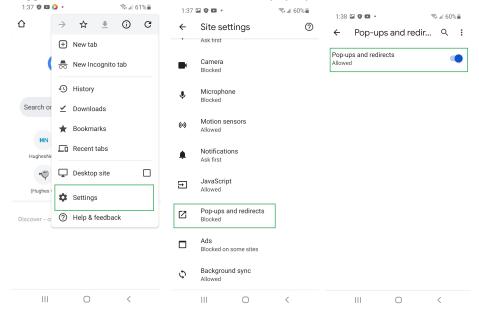

Disable block pop-ups on iOS devices:

- 1. Open Settings on your iPhone.
- 2. Search "pop-ups" and select "Block Pop-ups"
- 3. Turn off the toggle for Block Pop-ups for Safari

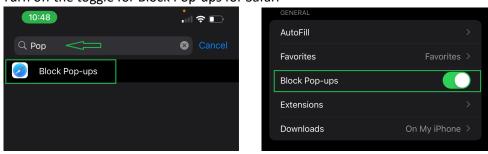



27. OVT/IV is failing

28.

- a. When the installer launches the OVT/IV successfully in a mobile browser, the rest of the site validation steps & checks happen outside the OASIS app in OVT/IV tool through mobile web-browser.
- b. Any issue in the OVT/IV tool while running the validation checks or to retrieve the Signoff's, please reach "Install Support" for help
- c. Once OVT/IV checks are passed and unable to retrieve the SignOff's in OASIS, make sure the SignOff#'s are available in both OVT/IV tool and Installation Portal (IP) before trying to retrieve in OASIS.
- Unable to connect OASIS with VSAT terminals like HT2300, HT2500 etc.,

a. <u>Refer section I.4</u>

- 29. Unable to find the parameters like LAN, WAN, etc., in OASIS
 - a. All the parameters including Site Parameters would be available in "FSO Details" step if you expand the Site/FSO section (as show below)
 - b. If you do not see all the required parameters available in OASIS, please call Install support to get the necessary information.

			and All	Collapse All
Pay Code		Customer St	ore Configuration	
So Hardware Program Current -) Parameters 	Ste F1	SALESOFANNEE GATEWATION COMMISSIOND. COMMISSIOND. FIRSTEGISTRA STATUSCHANG STATUSCHANG STATUSCHANG STATUSCHANG STICHASWIEDRA GUIDEN 40 LONGTUDE VI CURRENTDULJ CURRENTDULJ DEVECTIVEOR DEVECTIVEOR DEVECTIVEOR	77815*** hoStar 19 Commissioned Account .Direct ITE-sol(98)2017 12:06:00 WIDDS Veb/ TECS0(98)2017 12:06:00 WIDDS Veb/ TECS0(98)2017 12:06:00 ERCOUETDATE-sol(98)201 LI- 12:00 GSTER:No GSTER:No GSTER:No GSTER:No GSTER:No SSTER:NO SSTER:NO	oned Account 7 10:06:00

30. Unable to find the Part in "ZTP" workflow step to activate.

c.

- a. In BOM step, make sure the specific part you are trying to scan is ZTP enabled.
- b. The ZTP enabled parts can be identified in OASIS using the special icon (as shown below)
- c. Make sure installer scan all the required barcodes for the part selected. Ex: For Cradlepoint CBA850, remember to scan Serial#, IMEI and MAC barcodes



OTHERS (Optional)		×]
Are you sc	anning SIN	1 card? 🔵 Yes 💿 N	0	
P/N	150336	2-0022	Q	
Cradlepo	int Mobile I	Broadband Adapter Ki	it	
		Device Type		
ا 🗹 🏈	s ZTP	СВА	`	
Condition		Inv Category		
New	•	Consigned	•	
		Ļ		
S/N	64633	622554573		
IMEI	00305	7547437585		
MAC	35337	4763657		
				Fig: 28.0

- 31. Unable to activate the device/SIM through ZTP
 - a. Make sure you select the right ZTP part and scanned all the required barcodes in the previous step "BOM" (as shown above in Fig: 28.d)
 - b. Navigate to "ZTP" step and verify all the part & serial information displayed on the screen.
 - c. ******Before you click "Assoc" make sure you selected the correct SAN from the dropdown available to associate the device.
 - d. **If you notice a wrong SAN has been submitted accidentally, first you need to disassociate the wrong SAN from the device using "De-Assoc" option and wait for the success message and the device status is returned to 0%. Then you can select the correct SAN from the dropdown available (as show below) and click "Assoc" again to associate the latest SAN with the device.

Cradlepoint Mobile Broadban Adapter Kit S/N: 64633622554573	d 0% V	
Site Type - SAN		
Router - DEG3220003337D	• 00	
P/N	1503362-0022	
DEVICE TYPE	СВА	
S/N	64633622554573	
ICCID		
IMEI	003057547437585	
MAC	353374763657	
LAST UPDATE		
NEXT POLL		
Status		



- e. If you notice the device status is not progressing from 0%, wait for few mins (typically not longer than ~10min) and try "Check" option manually if periodic status check isn't running automatically in the background.
- f. If the issue has not been resolved and unable to proceed with OASIS, as a fallback procedure you can also activate the device outside the OASIS application using WebZTP or through manually installing the packages using a laptop. Report this issue to OASIS support.
- g. It is important to note that activating a device through webZTP is not a standard and recommended practice unless you have a valid issue that prevents you from using the OASIS application. Report this issue to OASIS support.
- h. Instructions to activate the device outside OASIS (using webZTP or through manual installation) are captured in the training videos & install specification documents.
- i. If you still notice the same behavior in WebZTP/Other, please call Install Support for more help to activate the device.
- j. If the device is activated successfully outside the OASIS app, installer still needs to proceed with next workflow steps in OASIS and can submit the Departure Complete/Incomplete & upload the data without any issues.
- 32. How to remove a part that is not listed as being onsite. (New Updated on 03/17/23)
 - a. In BOM step, use "Recover Additional Parts" option to add an asset that is not listed onsite.
 - b. Enter or scan the part number in "P/N" field, then try the look up (click on magnifying glass icon) to download the part configuration.
 - c. Make sure you fill in all the required details like S/N if the part is serialized, enable ZTP checkbox and pick the device type if part is ZTP enabled, make sure you pick the recovery status and reason code to successfully collect the asset information in OASIS.
 - d. Note: By default quantity is collected as "1" for each additional entry, enhancement to support multiple Quantities is work in progress.

12:02 ◀	12:05 ◀ ∢Search	
DODS BOM ZTP Install Extras I	Before Photos BOM ZTP Instal	
Expand All Collapse All	Expand All Collapse All	
Standard Wireless Repair DEG000110214 301 6714975	Standard Wireless Repair Assets (Others) Standard Wireless DEG000110214 6714975 Use magnifying glass icon for	
Assets/RMA	Assets (Others) glass icon for part look up.	
Managed Router DEG000110215 213	Desc INNER BOX,RAPID CHARGER	
+ Add Part		
Assets/RMA 🗸	S/N 962673737738373	
+ Recover Additional Parts	Recovery Status	
Router DEG000110217 437 ~	Reason	
- Arid Part	Physical damage v	




- How to disassociate the ZTP device/Sim that is recovered from the location?
 (New Updated on 03/17/23)
 - a. In BOM Step, select an asset(device/sim) in OASIS if listed under FSO/Site.
 - b. If not listed onsite, use "Recover Additional Parts" option to add an asset manually.
 - c. Make sure you fill in all the required details like S/N if the part is serialized, enable ZTP checkbox and pick the device type, make sure you pick the recovery status and reason code to successfully collect the asset information in OASIS.
 - d. Go to ZTP step, verify the recovered asset is listed under the "Existing Assets/Recovered Parts" section.
 - e. Verify all the part & serial information displayed on the screen.
 - f. **Before you click "De-Assoc" make sure you selected the correct SAN from the dropdown available to disassociate the device.
 - g. Click "De-Assoc" option and wait until the device/SIM is successfully deactivated.

Existing Assets /Recovered Parts	De-Assoc A	• ~
SIM Card,Verizon,Triple Punch (Gemalto) S/N: 19283637737277373737	0%	~
Site Type - SAN		
Wireless Modem - DEG000110214	806	
P/N	1503362	-0035
Device Type		SIM
S/N (ICCID) 1928	36377372773	73737
Host by S/N		
Host by IMEI 9	28373637626	26377
Host by MAC		
HOST BY		
LAST UPDATE		
NEXT POLL		
Status		
🗢 Check 🤗 I	De-Assoc	


- 34. Some of the steps are not checked in OASIS workflow page in Installation Portal?
 (New Updated on 03/17/23)
 - a. The VSAT terminal steps are optional in OASIS Mobile app, installer is allowed to skip if needed and submit departure complete by completing the required steps alone. So, any of these steps if skipped will be marked as incomplete and would show as unchecked in OASIS summary page in IP after the upload.
 - b. Also, it's rare and intermittent, OASIS summary page in IP can show some additional steps which are not part of the OASIS Mobile app flow. These additional steps are optional and are shown/hidden in mobile app based on the FSO configuration rules during the install/repair process. In such scenarios, workflow page in IP could still show these additional steps and mark these as unchecked and would recommend users to ignore those steps during the review process.



- 35. Encountering errors with photo audit in OASIS (New Updated on 03/17/23)
 - a. Enterprise photo audit process in OASIS is real-time which requires internet. So, make sure Installation portal is reachable with good connectivity.
 - b. The app will display "No Connectivity" error as show below to the user when they don't have internet connectivity.

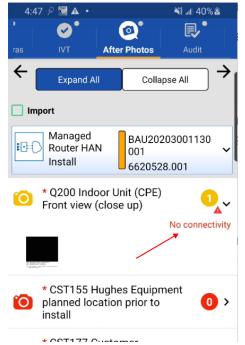

d. The app will display "Connection timeout" error as shown below to the user when the request from the app to Installation Portal times out. If the user remains on this screen, the app will try to retry sending the request.

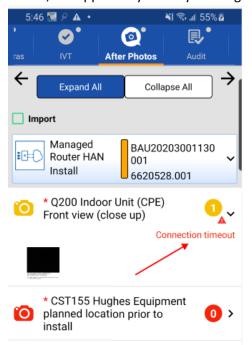

e. Instead, if receiving "Not Qualified" error but if you believe the photo is having good quality and would pass an installation audit, then tap "Proceed" to keep the photo. Otherwise, try to re-capture the image for a better photo.



c.

36. How to run Installation Verification (IV) or OVT when offsite?

(New – Updated on 03/17/23)

- a. In OASIS Arrival screen, use "Arrival-Not Onsite" option to re-run the IV/OVT if the site is complete but having issues with IV/OVT.
- b. "Arrival-Not Onsite" option is strictly recommended to use when Install/Repair is complete but having issues with IV/OVT at the customer location.
- c. So, OASIS allows to re-run the IV/OVT without being to customer location using the "Arrival-Not Onsite" flow which allows technicians to access limited steps in OASIS.
- d. Use regular "Arrival Onsite" option if working at the customer location.

	1:37		al 🗟 🛙	
•	٠	<u> </u>	₿*	
ite	GPS	Arrival	Safety	Befor
←				\rightarrow
(Expand All		Collapse All	
	Select All			
	Router		DEG000110: 437	217
	Standard	l Wireless	DEG000110: 4301	21
	wireless	Modem	DEG000110: 4806	21
		Arrival On Site	e	
	Arı	rival - Not Ons	site	-

- 37. Unable to access the install steps (Safety, BOM, ZTP, Photos) after Arrival?
 - a. Make sure the IVR submitted is "Arrival Onsite" but not "Arrival Not Onsite".
 - b. If accidentally submitted the "Arrival Not Onsite", proceed to departure step, submit Departure Incomplete and then re-arrive using "**Arrive Onsite**" option (as highlighted in screenshot below)






e.

- 38. Unable to retrieve OVT signoff# and blocking the departure.
 (New Updated on 03/17/23)
 - a. Make sure Installation portal is reachable through mobile browser.
 - b. Make sure OVT is complete and Signoff# is posted to IP.
 - c. If you are trying to retrieve the signoff# in OASIS immediately after completing the checks in OVT, it's a known issue in OVT causing some delays to post the Signoff# to IP which could be a potential reason for not able to retrieve in OASIS App. So, we recommend you try again after some time (15min).
 - d. Use "Retrieve SignOff#" in OASIS to try retrieving the sign offs.
 - e. If unable to retrieve the signoff# but if the signoff# is available in OVT or IP systems, tap on the OVT field to manually enter
 - f. If copying or manually entering the signoff# in OASIS, to avoid the delays in closure and to prevent the data inconsistency between the systems, **make sure the signoff# entered in OASIS matches with the actual signoff# produced by the OVT system.**

Retrieve SignOff#	Launch LUI
Jup ter Repair	DSS200035469 6724568
ESN:	
OVT SignOff# (Optional)	
Туре	Date
	Launch OVT
Click here to manually en to retrieve automat	

- 39. Unable to Enroute in OASIS (New Updated on 03/17/23)
 - a. **Enroute process is real-time and requires internet.** Make sure you have a good connectivity and Installation portal is reachable through mobile browser.
 - b. If you are unable to enroute due to connectivity issues or **offline**, please proceed to Customer location as prompted in OASIS App (Shown below).



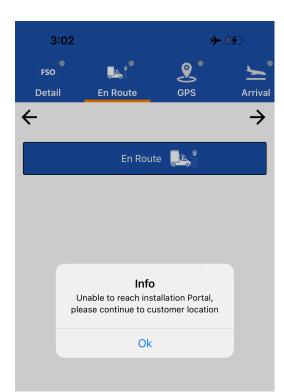

- c. Also note that, **you can enroute to only one location at a time**. If you already submitted enroute to one location and trying to enroute to a different location, make sure you Abort on the first location before you start enroute on the other.
- d. Also, if you notice the Enroute button is disabled in OASIS, make sure the order status is either "Confirmed" or "Suspended" before you try enroute. OASIS won't allow you to enroute if order status is already "Onsite" or "Canceled" or "Completed".
- 40. Not installing any ZTP device but still showing up in the workflow

(New – Updated on 03/17/23)

- a. ZTP step is configured as optional step in both OASIS App and workflow summary page in IP.
- b. You are allowed to skip this step if not installing any ZTP device.
- 41. Unable to skip "Diagnosis" step in OASIS. (New Updated on 03/17/23)
 - a. Diagnosis Step in OASIS is applicable for only VSAT(Jupiter) Repairs.
 - b. It's highly recommended to collect the VSAT initial state code before starting the repair process. So, make sure the terminal is powered ON and phone is connected to the Hughes Wi-Fi to let OASIS collect the initial state code while launching this step.
 - c. If OASIS is unable to communicate with the terminal, the connection is going to timeout after 1min, and app is going to pop up with a "Try Again" option.
 - d. Click "Try Again" and if still not successful with the second try, then OASIS is going to provide an additional skip option i.e. "Skip **this step**" if user likes to skip this step in the workflow (as shown below).



3:03 all Ϛ	B	3:04	all ≎	1	3:()5		al 🗢 🛙	%)
* 🖉 **	~	Sat Info Diag	nosis LOS	Befor	al S	at Info	Diagnosis	LOS	Befc
Al Sat Info Diagnosis LOS	Allow Ping TESN:	Terminal: Fa	iled	÷	Ping Ter ESN:	minal:	Failed		→
Downlink Esno: Ping Installer Success Portal:			uccess		Downlin Ping Ins Portal:		Success		
Terminal State State Desc Running Diagnosis Warn-2802: Please wait, do not touch the Modem	Termi State State Desc	Error-2801: Termina Error-2801: Termina Code is Unavailable ri Terr	, Please Connect to ninal		Termin State State Descri	Code is Una	Warning Terminal (IDU) Arr vailable, Please Co Terminal	onnect to	
Ping & Retrieve State Code Open OVT Open Site Hist	pry	Open OVT	Open Site Hist	ory		Skip This : Open OVT		Again	у

- 42. OASIS Error pop ups are added with "Recommendations" link for the Android App. (New Updated on 03/17/23
 - a. For example, if user tries to perform sync on home screen without having internet connectivity, the below error popup will be displayed with those recommendations for user to try on their own before reaching out for support.


3:50 🖗 🛦 🛦 🔸	¥⊱,⊪⊨24% ≧	3:58 🖉 🛦 ▲ • 👋 👪 26% ä	8
Test Env SIT2 Offline	▲ =	Test Env Hughes OASIS SIT2 Offline	:
Calendar List	Мар	Calendar List Map	
Previous Job Schedules		Previous Job Schedules 0	>
Last Refreshed On:	0 >	Error	>
Current Job Schedules	0 >	Error-1000: Installation Portal (IP) is Unavailable. Please Check your Network Connection.	>
Error	>	Recommendations -	
Error-1000: Installation Por is Unavailable. Please Chec		Verify Wi-Fi settings and make sure you have a stable and strong	<i>_</i>
Network Connection.		Internet connection (i.e. not 3G or 4G) Make sure the Installation Portal is	
Recommendations		operational by logging in via a web browser.	
×.	ок	С	
	_		
Technician Badge			

c. For example, if a user is in a remote location where the phone is not able to capture the accurate GPS close to the customer location, the below warning popup will be displayed with those recommendations for user to try on their own before reaching out for support.



b.

Last update: 07/18/2023 version: 1.4

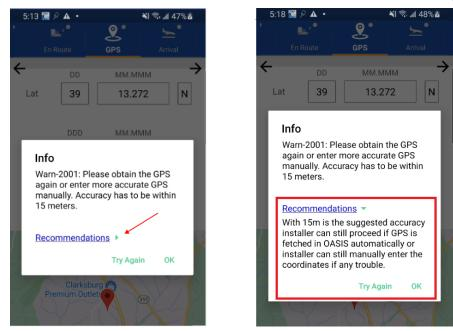

43. OASIS showing new tab "Software" in the workflow (New – Updated on 06/29/23)

- a. This feature is introduced from **OASIS 7.15.08 to support the HT3XXX (Ex: HT3000W)** terminals to let installers update the "Terminal Software" through OASIS.
- b. When the installer logs in to OASIS, the app will try to look for any software updates are available and will automatically start downloading the updates from server . If the download is in progress, the status is visible on the top banner (highlighted below)
- c. We recommend installers to hold until this download is complete before proceeding to customer location and install process.

12:00		al 🗢 🖾
	Hughes OASIS Online	🔺 🗄
Warn-4036	oftware download in pro 5: Please make sure the la aded before you proceed scation	itest updates
Calendar	List	Мар
	Job Schedules ed On: 05/26/2023 11:67:4	2 EDT 0 >
	lob Schedules ed On: 05/26/2023 11:57:4	2 EDT 2 >
C Hughes I Last Refresh	lotes ed On: 05/26/2023 12:00:1	s edt
C Announc	ements ied On: 05/26/2023 12:00:1	s edt
¥ Tools (Of	fline)	
④ Technicia	an Badge	
Sync Ful	IIP All Records Co	ntig Support


 d. The downloaded software Information is also visible to installers through Home (Bottom bar) → config → Terminal Software Updates (ref below screenshots)



d.

11:59	al 🗢 🖬	11:59 all 후 🕻
← User Configuration		← Terminal Software Updates
(1) Account	IN5	Select All
() Terminal Software Updates	>	Software HT2XXX Software HT2XXX Software Description for HT2XXX Up to date
Schedule Days	7 Days 🔻	Software Description for HT2XXX Up to date
Sync Interval(Download)	Never v	8.2.1.2 HT3XXX software bundles Up to date
Sync Interval(Upload)	15 Mins 🔻	
Sync Data (Select Network)	Always 🔻	
Auto-Upload Photos (Select Networ	rk) Always ₹	
Photo Resolution	Medium 🔻	
App Theme	Light 🔻	
Export to Gallery	Yes 🔻	
Zero-Touch Provisioning(ZTP)	Enable 🔻	
ZTP Poll-Interval	After 5 Sec 🔻	Download Software Update
Home Full IP Config	Logout	


- f. The Installers should see a new screen named "Software" just before the "SBC" screen in the workflow steps. Currently, this "Software" is a required step for HT3XXX terminal model only. For other terminal models, installers are allowed to skip this step with a reason code.
- g. When the Installer is on the "Software" screen and the device is connected to the terminal, the Oasis app will autodetect the current software version on the terminal and will update the installer:
 - i. Below is the scenario when new software updates are available.

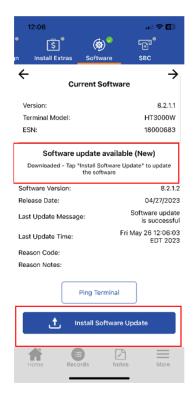



e.

ii. Here is the screenshot when terminal software is already up to date.

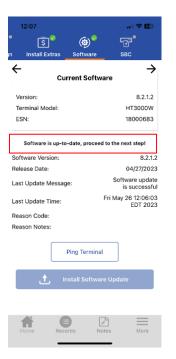

- 44. OASIS is not allowing user to do departure complete without completing the "Software" step. (New Updated on 06/29/23)
 - a. The "Software" is a required step in the workflow before departure complete. Installer needs to upload the new software (if it is available to upload) on to the HT3XXX terminal by tapping on the "Install Software Update" button.

12:06	al 🗢 🔯
•	(d) [©]
n install Extras So	oftware SBC
← Curren	t Software \rightarrow
Version:	8.2.1.1
Terminal Model:	HT3000W
ESN:	18000683
Downloaded - Tap "Insta	te available (New) Il Software Update" to update software
Software Version:	8.2.1.2
Release Date:	04/27/2023
Last Update Message:	Software update is successful
Last Update Time:	Fri May 26 12:06:03 EDT 2023
Reason Code:	
Reason Notes:	
Ping	Terminal
f Install	Software Update
Home Records	Notes More



b.

- c. However, the installer is also given an option to skip the software update under specific conditions as listed below, which will also mark the step as complete & allow the installer to do the departure complete:
 - i. The current software version is higher than the minimum software version (set by Engineering Team i.e., 8.2.1.31)
 - ii. The Terminal connected is not a HT3XXX terminal.

5:38 🔐 🕫 😰	5:38	al 🗢 😰	5:39 🕇	all 🗢 🔽	
' 🕄 🎯 🐨 🛓	¹¹ 5 @	SBC Sat In	51 Šੱ Sign Install Extras	Software SBC	Sat Ir
Sign Install Extras Software SBC Sat In ← → Current Software →	Sign Install Extras Software	SBC Sat In HT3000W 18000683	← cu	rrent Software	→
Version: 8.2.1.31	0-0	1-1- (N)	Version:	8.2.1	
Terminal Model: HT3000W ESN: 18000683	Software update ava Downloaded - Tap "Install Softw the softwar	are Update" to update	Terminal Model: ESN:	HT3000 180006	
Software update available (New)	Software Version:	8.2.1.33	Software u	pdate available (New)	
Downloaded - Tap "Install Software Update" to update the software	Release Date: Last Update Message:	06/13/2023	Downloaded - Tap "	Install Software Update" to update the software	
Software Version: 8.2.1.33	Last Update Time:		Software Version:	8.2	2.1.33
Release Date: 06/13/2023	Reason Code:		Release Date:	06/13/2	2023
Last Update Message:	Reason Notes:		Last Update Message:		
Last Update Time:			Last Update Time:		
Reason Code:	Ping Terminal	Skip Update	Reason Code:	Advised by Install Support/Hug	ghes
Reason Notes:		ordb obraato	Reason Notes:		Test
	Reason Code				
Ping Terminal Skip Update	Software download issue	*	Ping Terminal	Skip Update	
1. Install Software Update	Comments		t in	istall Software Update	
	Select Reason	Code Done			
	Advised by Install Su	pport/Hughes			
	Software down	oad issue			
Home Records Notes More	Terminal does not suppo Other	rt software update	Home Recor	rds Notes More	-

